



Technical Bulletin

Date: June 28, 2018

Product Line: Bambi


Models: Bambi MAX Bucket 1518-HL9800

Subject: Cam & Cable Drum Change

Background

Over adjustment of the valve cam in the clockwise direction can cause stretching of the drive cable. When the valve is opened, the slack in the cable snaps taut. This can lead to premature cable failure.

The cable drum has been changed to include a restrictor pin in the front face. The cams have been changed to include a slot which fits the restrictor pin and prevents over adjustment of the valve position.

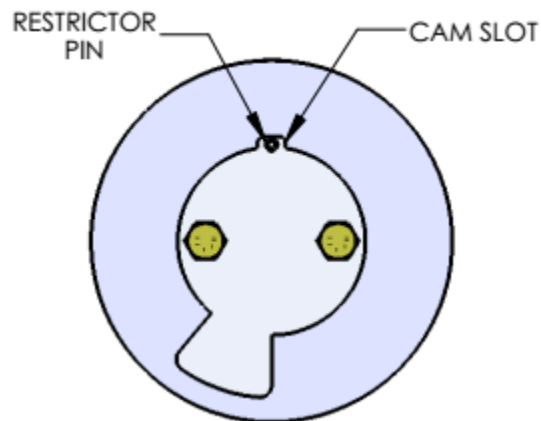

Recommendations

The older revisions of the cable drum and cam are not compatible with the newer versions without modification. If you are not experiencing problems with cable failures, it is not necessary to upgrade to the newer system.



Bambi
BUCKET
Driven by Innovation

Contact

For further details, please contact the following SEI representatives.

Alex Wutschnik, EIT

Product Engineer, Aerial Firefighting Division

604-946-3131 ext. 139

alexw@sei-ind.com

Robert Button, P.Eng

Product Engineer, Aerial Firefighting Division

604-946-3131 ext. 423

robert@sei-ind.com

This Technical Bulletin is available on the SEI website:

<http://www.sei-ind.com/category/bambi-safety-bulletins/>