



Technical Bulletin

Date: March 27, 2018

Product Line: Bambi


Models: Bambi Bucket 2024-4453

Subject: Medium Tripline Design Change

Background

Triplines failing immediately below the bullet assembly has been a recurring issue on medium Bambi Buckets. The root cause on medium buckets is believed to be the cable flexing during take-off and landing. A new design allows the cable to pivot freely immediately after the bullet to eliminate this issue.

The new design, 013057, will replace 005334. The new design is a direct replacement, and does not require any additional modification.

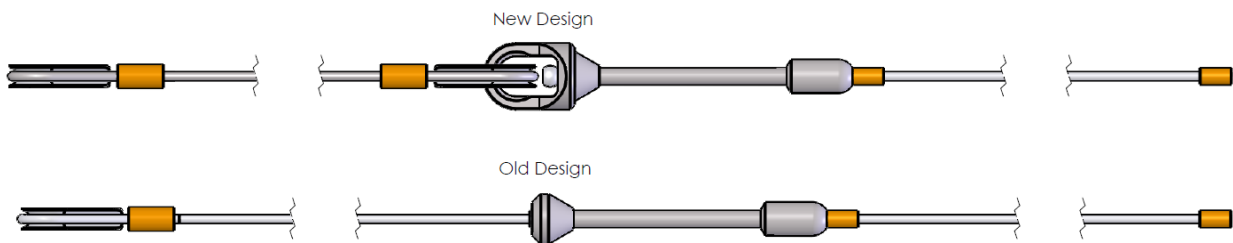

Recommendations

New triplines made by SEI will use the new design. Customers with the old design should continue to use those triplines if they have not encountered problems with them.



This Technical Bulletin is available on the SEI website. <http://www.sei-ind.com/resources/manuals>

For further details, please contact the following SEI representatives.

Contact

Alex Wutschnik, EIT
Product Engineer, Aerial Firefighting Division
604-946-3131 ext. 139
alexw@sei-ind.com

Robert Button, P.Eng
Product Engineer, Aerial Firefighting Division
604-946-3131 ext. 423
robert@sei-ind.com